



June 13, 2012

C8051F960 Rev A Errata

Errata Status Summary

Errata #	Title	Impact	Status
1	EMIF Split Mode Operation	Minor	Fixed – Rev A Date codes 1221 and later
2	Flash Lock Byte	Minor	Fixed – Rev A Date codes 1221 and later

Impact definition: Each erratum is marked with an impact, as defined below:

- Minor – Workaround exists.
- Major – Errata that do not conform to the data sheet or standard.
- Information – The device behavior is not ideal but acceptable. Typically, the data sheet will be changed to match the device behavior.

Errata Details

1. **Description:**

This issue may affect device functionality when using the external memory interface (EMIF) in the Split Mode configuration. In the split mode configuration, the EMIF may not function properly. In the Split Mode configuration, the behavior of the affected devices is similar to the EMIF internal only mode.

Impact:

Only designs using the EMIF in the Split Mode are impacted. Please note that this does NOT affect devices when using the EMIF in the Internal Only or External Only configurations. Designs not using the EMIF are not impacted.

Workaround:

If access to an external parallel peripheral is required, using the affected devices, the workaround is to configure the EMIF in the external only memory configuration.

Resolution:

Fixed for product with date code 1221 and later.

This date code is for year 2012, work week 21 (Week ending May 26th 2012).

2. **Description:**

On C8051F96x devices with 128k Flash memory (C8051F960-A-GM, C8051F960-A-GQ, C8051F961-A-GM, C8051F962-A-GM, C8051F962-A-GQ, C8051F963-A-GM), writing 0x00 to the lock byte will lock the device and prevent future erases.

Impact

Affected devices programmed and then locked by writing 0x00 to the lock byte are locked and cannot be erased. Please note that this does NOT affect devices with on-chip Flash memory < 128k bytes.


Workaround

The workaround is to write 0x80 to lock the entire flash on the affected devices. This will not prevent future erases. It is not necessary to write 0x00 to lock the entire Flash. On devices with date code 1221 and later, writing 0x00 to the lock byte will lock the entire Flash, and the device can be erased.

Resolution

Fixed for product with date code 1221 and later.

This date code is for year 2012, work week 21 (Week ending May 26th 2012).

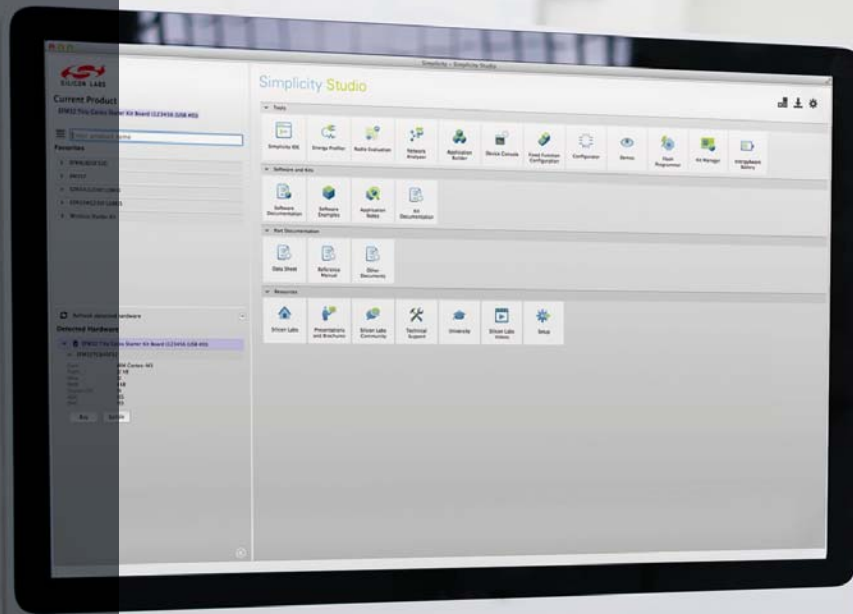

Simplicity Studio

One-click access to MCU and wireless tools, documentation, software, source code libraries & more. Available for Windows, Mac and Linux!



IoT Portfolio
www.silabs.com/IoT



SW/HW
www.silabs.com/simplicity



Quality
www.silabs.com/quality



Support and Community
community.silabs.com

Disclaimer

Silicon Laboratories intends to provide customers with the latest, accurate, and in-depth documentation of all peripherals and modules available for system and software implementers using or intending to use the Silicon Laboratories products. Characterization data, available modules and peripherals, memory sizes and memory addresses refer to each specific device, and "Typical" parameters provided can and do vary in different applications. Application examples described herein are for illustrative purposes only. Silicon Laboratories reserves the right to make changes without further notice and limitation to product information, specifications, and descriptions herein, and does not give warranties as to the accuracy or completeness of the included information. Silicon Laboratories shall have no liability for the consequences of use of the information supplied herein. This document does not imply or express copyright licenses granted hereunder to design or fabricate any integrated circuits. The products must not be used within any Life Support System without the specific written consent of Silicon Laboratories. A "Life Support System" is any product or system intended to support or sustain life and/or health, which, if it fails, can be reasonably expected to result in significant personal injury or death. Silicon Laboratories products are generally not intended for military applications. Silicon Laboratories products shall under no circumstances be used in weapons of mass destruction including (but not limited to) nuclear, biological or chemical weapons, or missiles capable of delivering such weapons.

Trademark Information

Silicon Laboratories Inc., Silicon Laboratories, Silicon Labs, SiLabs and the Silicon Labs logo, CMEMS®, EFM, EFM32, EFR, Energy Micro, Energy Micro logo and combinations thereof, "the world's most energy friendly microcontrollers", Ember®, EZLink®, EZMac®, EZRadio®, EZRadioPRO®, DSPLL®, ISOModem®, Precision32®, ProSLIC®, SiPHY®, USBXpress® and others are trademarks or registered trademarks of Silicon Laboratories Inc. ARM, CORTEX, Cortex-M3 and THUMB are trademarks or registered trademarks of ARM Holdings. Keil is a registered trademark of ARM Limited. All other products or brand names mentioned herein are trademarks of their respective holders.



SILICON LABS

Silicon Laboratories Inc.
 400 West Cesar Chavez
 Austin, TX 78701
 USA

<http://www.silabs.com>